City of Wichita, Kansas Americans with Disabilities Act Transition Plan

Seneca Park

Address

July 2005



Prepared by

DMCG

Disability Management Consulting Group L.L.C.

2801 Jonquil Place Columbia, MO 65202

In conjunction with

The Great Plains ADA & IT Center and the City of Wichita Disability Advisory Board

City of Wichita - ADA/504 Transition Plan - Seneca Park - July 2005 Legend: Blue font identifies hyperlinked documents - Red font indicates recommended changes to structures or policies

Locations	Structural Inconsistencies		Recommended Corrections/Modifications to Ensure Program Access	Criteria – L=low, M=medium, H=high				mental Technical nformation	Finalized Actions			
Location	Identified Issue	ADAAG Specifications	Recommended Correction	Priority (overall)	Public Access	Frequency - PWD	Photo #	Conceptual Costs	Support Information	Finalized Correction	Date to be Corrected	Date Completed (Include initial)
1. Curb Ramps	The curb ramps, leading to this park from the street, do not provide appropriate detectable warning surfaces.	4.7.7	Since these curb ramps lead to a cross vehicular traffic way, the necessity of detectable warning surface is magnified. The existing curb cut has a detectable warning surface. However, this detectable warning does not comply with current ADAAG specifications regarding truncated domes. Modify the existing curb cut to comply with ADAAG specifications pertaining to a detectable warning surface.	H	Н	M	0	\$500	Detectable Warning Suspension Detectable Warning Specifications #1, #2			
2. Drinking Fountain	The faucet control, on the drinking fountain, is not within specified reach range.	4.1.3(10)	According to ADAAG, the number of all facilities and elements, which are required to be accessible, are delineated in ADAAG section 4.1. However, 4.1 only addresses drinking fountains in reference to floors of a building or facility. The program access provisions of Title II require all programs and services to be accessible and usable. Drinking fountains are a service provided by the City and must be made accessible. The number of drinking fountains that are required to be accessible in a park or play area setting is debatable, but we consider that at least one at this particular park should be fully accessible to individuals who use wheelchairs. Modify the existing drinking fountain to comply with ADAAG specifications for individuals who use wheelchairs, including spout height. Additionally, we recommend providing a hilo fountain where the existing fountain is located.	L	M	M	3	\$300	Building Block 7 – Drinking Fountains Sample hi-lo fountain in park setting			
	All other features and structures comply fully with ADAAG and the Play Areas – Final Rule.											

Seneca Park - Conceptual Cost Projections

Total	\$800
Year One (Very High)	\$0
Year Three (High)	\$500
Year Five (Medium)	\$0
Year Ten (Low)	\$300